

SlimPRO Calibration Instructions

- 1. Press and hold **UNIT** button (on the bottom of the scale).
- 2. Install the batteries. All display segments will turn on.
- 3. Press **UNIT** button 4 times quickly and hold **UNIT** button on the fourth press until the scale shows the zero count.
- 4. Press **UNIT** button, and place the scale on the table or bench in 4 seconds.
- 5. The scale will show " $\mathcal{O}.\mathcal{O}$ kg" and then " $\mathcal{S}5.\mathcal{O}$ kg".
- 6. Put 65kg of calibrated test weight on the scale.
- 7. The scale will show "135.0 kg".
- 8. Put 135kg of calibrated test weight on the scale.
- 9. The scale will show "PRSS", and then power off automatically.